

Engineering Drawings

The Blank Engineering Drawing Form

		PART	REV	DATE
		2.007 Design & Manufacturing I		
		TITLE		
		MAT'L	SCALE	SHEET
		DRAWN BY		FILE
UNITS/TOL		Section	Instructor	
ANSI Standard				

This blank template can be printed off the 2.007 locker on Server. You can use this form to make your own production drawings for class. This will get you used to the look and feel of an engineering drawing.

To print this file from Server:

```
server% add 2.007
```

```
server% lpr -P<printer name> /mit/2.007/blankdrawing.ps
```

Engineering Drawing and Sketching

Drawing Handout Index

- [Isometric Drawing](#)
- [Orthographic or Multiview Drawings](#)
- [Dimensioning](#)
- [Sectioning](#)
- [Drawing Tools](#)
- [Assembly Drawings](#)
- [Cross-Sectional Views](#)
- [Half-Sections](#)

- [Sections of Objects with Holes, Ribs, etc.](#)
- [More Dimensioning](#)
- [Where to Put Dimensions](#)
- [Reference Dimensions](#)
- [Dimension Center Lines](#)

Introduction

One of the best ways to communicate one's ideas is through some form of picture or drawing. This is especially true for the engineer. The purpose of this guide is to give you the basics of engineering sketching and drawing.

We will treat "sketching" and "drawing" as one. "Sketching" generally means freehand drawing. "Drawing" usually means using drawing instruments, from compasses to computers to bring precision to the drawings.

This is just an introduction. Don't worry about understanding every detail right now - just get a general feel for the language of graphics.

We hope you like the object in figure 1, because you'll be seeing a lot of it. Before we get started on any technical drawings, let's get a good look at this strange block from several angles.

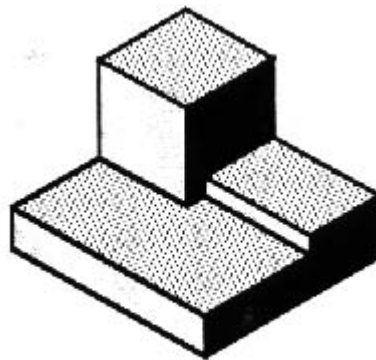


Figure 1 A machined block

Isometric Drawing

The representation of the object in figure 2 is called an isometric drawing. This is one of a family of three-dimensional views called pictorial drawings. In an isometric drawing, the object's vertical lines are drawn vertically, and the horizontal lines in the width and depth planes are shown at 30 degrees to the horizontal. When drawn under these guidelines, the lines parallel to these three axes are at their true (scale) lengths. Lines that are not parallel to these axes will not be of their true length.

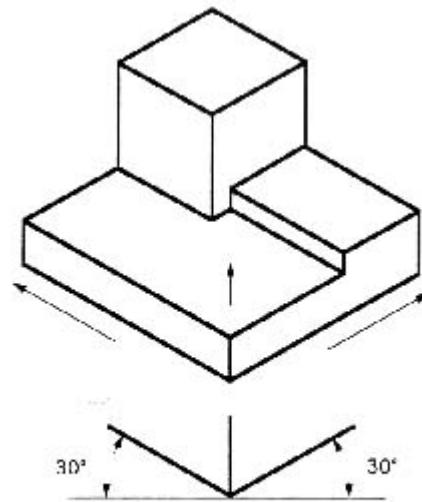


Figure 2 An isometric drawing

Any engineering drawing should show everything: a complete understanding of the object should be possible from the drawing. If the isometric drawing can show all details and all dimensions on one drawing, it is ideal.

One can pack a great deal of information into an isometric drawing. Look, for instance, at the instructions for a home woodworker in figure 3, taken from the Popular Mechanics magazine. Everything the designer needs to convey to the craftsperson is in this one isometric drawing.

However, if the object in figure 2 had a hole on the back side, it would not be visible using a single isometric drawing. In order to get a more complete view of the object, an orthographic projection may be used.

Orthographic or Multiview Drawing

Imagine that you have an object suspended by transparent threads inside a glass box, as in figure 4.

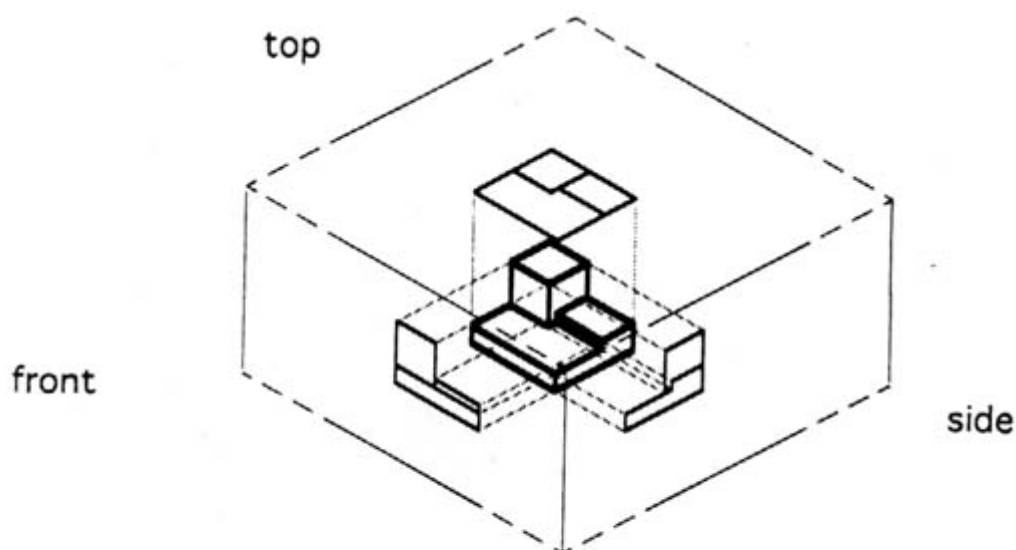


Figure 4 The block suspended in a glass box.

Then draw the object on each of three faces as seen from that direction. Unfold the box (figure 5) and you have the three views. We call this an "orthographic" or "multiview" drawing.

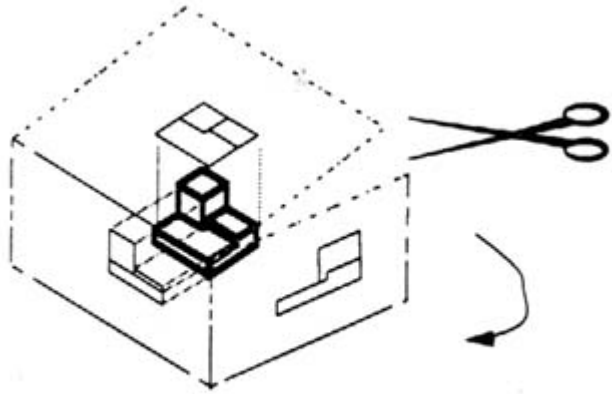


Figure 5 The creation of an orthographic multiview drawing

Figure 6 shows how the three views appear on a piece of paper after unfolding the box.

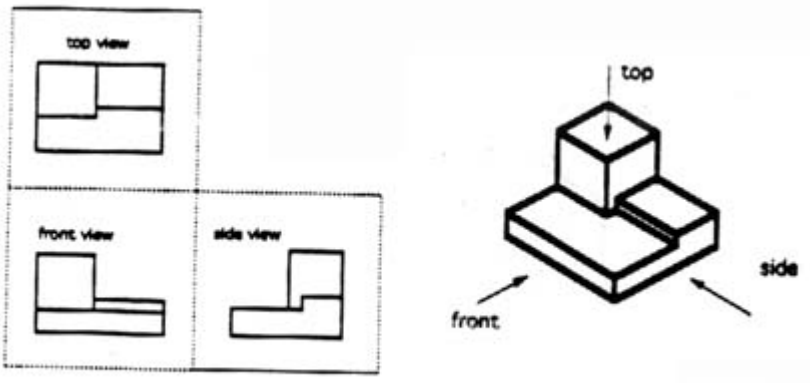


Figure 6 A multiview drawing and its explanation

Which views should one choose for a multiview drawing? The views that reveal every detail about the object. Three views are not always necessary; we need only as many views as are required to describe the object fully. For example, some objects need only two views, while others need four. The circular object in figure 7 requires only two views.

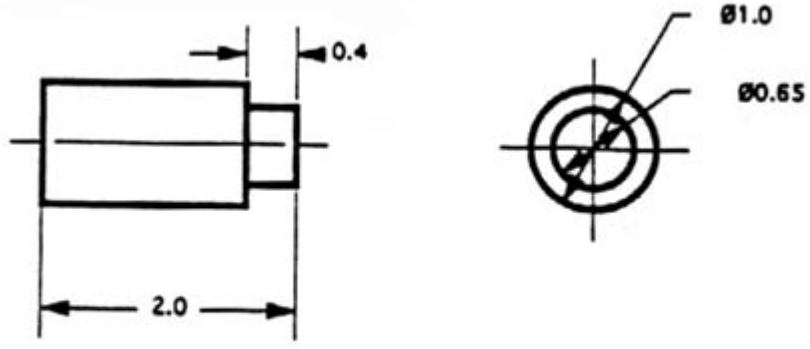


Figure 7 An object needing only two orthogonal views

Dimensioning

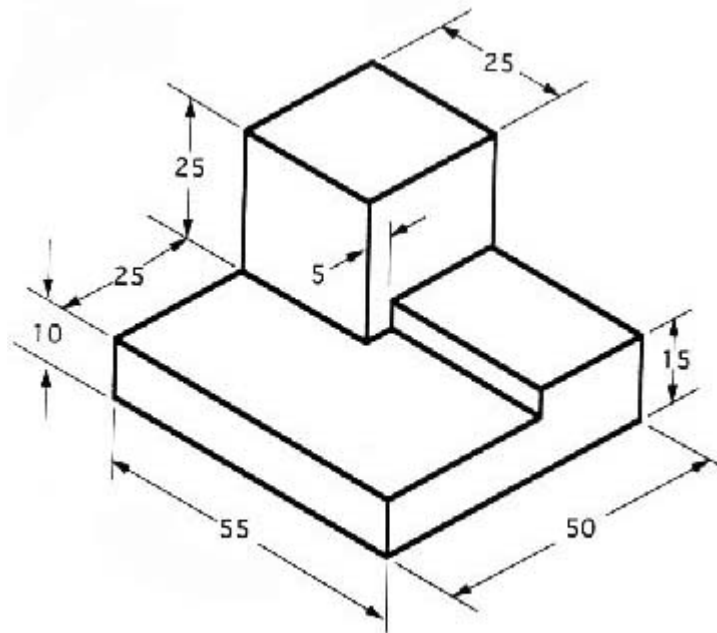


Figure 8 An isometric view with dimensions

We have "dimensioned" the object in the isometric drawing in figure 8. As a general guideline to dimensioning, try to think that you would make an object and dimension it in the most useful way. Put in exactly as many dimensions as are necessary for the craftsperson to make it -no more, no less. Do not put in redundant dimensions. Not only will these clutter the drawing, but if "tolerances" or accuracy levels have been included, the redundant dimensions often lead to conflicts when the tolerance allowances can be added in different ways.

Repeatedly measuring from one point to another will lead to inaccuracies. It is often better to measure from one end to various points. This gives the dimensions a reference standard. It is helpful to choose the placement of the dimension in the order in which a machinist would create the part. This convention may take some experience. It is covered later (figures 49-52).

Sectioning

There are many times when the interior details of an object cannot be seen from the outside (figure 9).

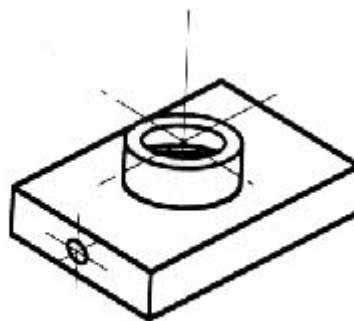


Figure 9 An isometric drawing that does not show all details

We can get around this by pretending to cut the object on a plane and showing the "sectional view". The sectional view is applicable to objects like engine blocks, where the interior details are intricate and would be very difficult to understand through the use of "hidden" lines (hidden lines are, by convention, dotted) on an orthographic or isometric drawing.

Imagine slicing the object in the middle (figure 10)

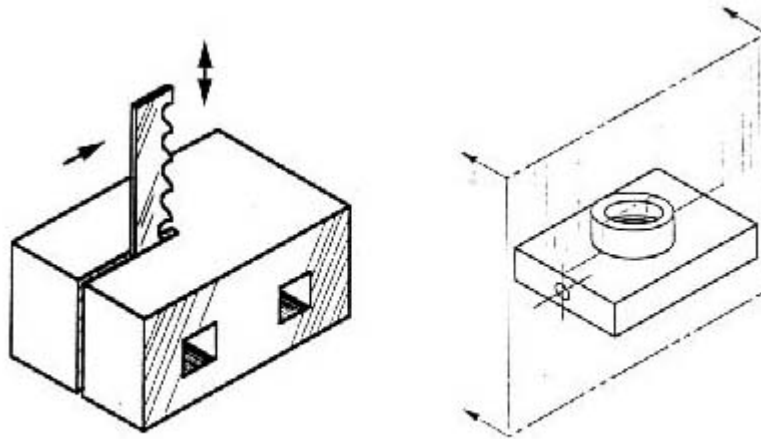


Figure 10 "Sectioning" an object

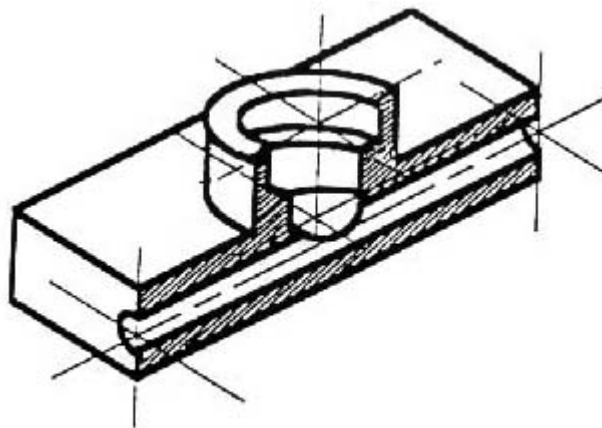


Figure 11 Sectioning the object in figure 9

Take away the front half (figure 11) and what you have is a full section view (figure 12).

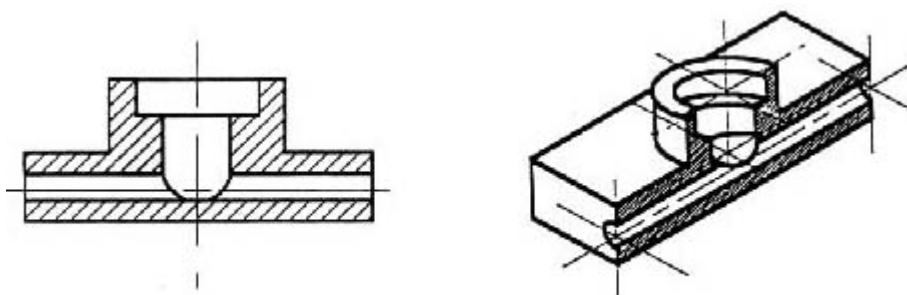


Figure 12 Sectioned isometric and orthogonal views

The cross-section looks like figure 12 when it is viewed from straight ahead.

Drawing Tools

To prepare a drawing, one can use manual drafting instruments (figure 13) or computer-aided drafting or design, or CAD. The basic drawing standards and conventions are the same regardless of what design tool you use to make the drawings. In learning drafting, we will approach it from the perspective of manual drafting. If the drawing is made without either instruments or CAD, it is called

a freehand sketch.

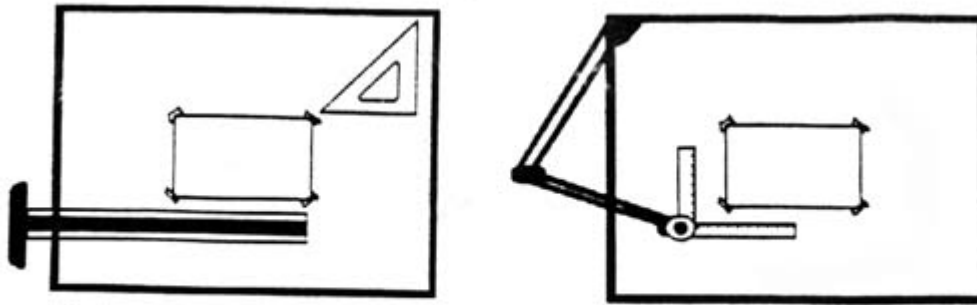
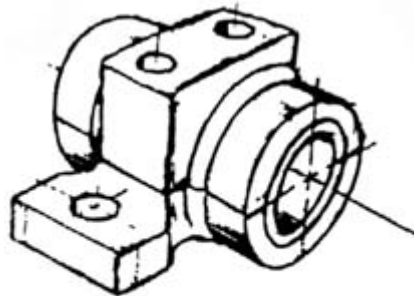


Figure 13 Drawing Tools

"Assembly" Drawings

An isometric view of an "assembled" pillow-block bearing system is shown in figure 14. It corresponds closely to what you actually see when viewing the object from a particular angle. We cannot tell what the inside of the part looks like from this view.

We can also show isometric views of the pillow-block being taken apart or "disassembled" (figure 15). This allows you to see the inner components of the bearing system. Isometric drawings can show overall arrangement clearly, but not the details and the dimensions.



*Figure 14 Pillow-block
(Freehand sketch)*

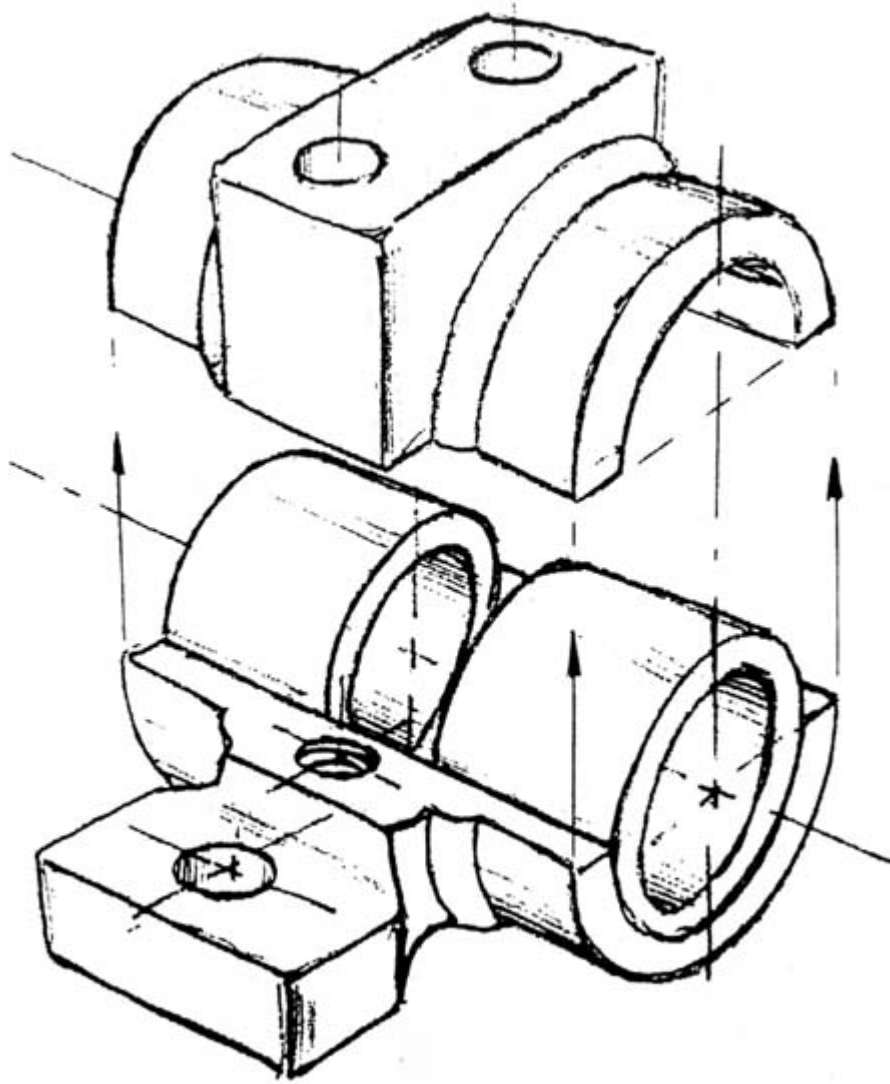


Figure 15 Disassembled pillow-block

Cross-Sectional Views

A cross-sectional view portrays a cut-away portion of the object and is another way to show hidden components in a device.

Imagine a plane that cuts vertically through the center of the pillow block as shown in figure 16. Then imagine removing the material from the front of this plane, as shown in figure 17.

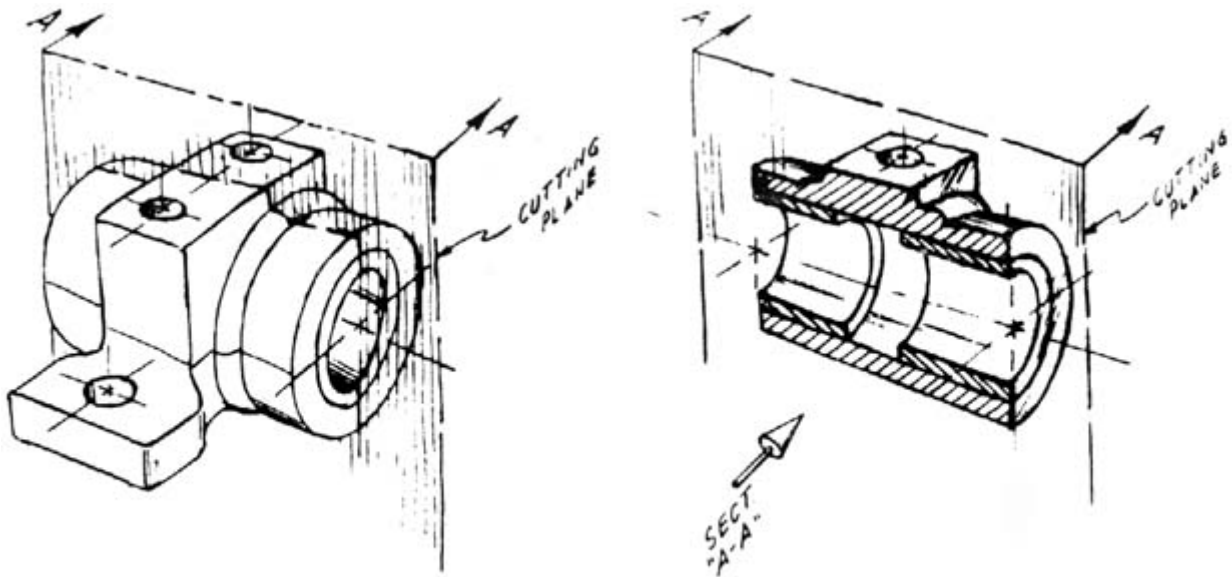


Figure 16&17 Pillow block

This is how the remaining rear section would look. Diagonal lines (cross-hatches) show regions where materials have been cut by the cutting plane.

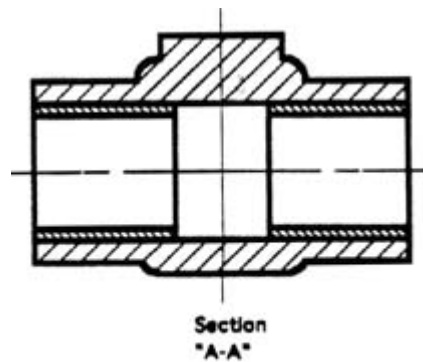


Figure 18 Section "A-A"

This cross-sectional view (section A-A, figure 18), one that is orthogonal to the viewing direction, shows the relationships of lengths and diameters better. These drawings are easier to make than isometric drawings. Seasoned engineers can interpret orthogonal drawings without needing an isometric drawing, but this takes a bit of practice.

The top "outside" view of the bearing is shown in figure 19. It is an orthogonal (perpendicular) projection. Notice the direction of the arrows for the "A-A" cutting plane.

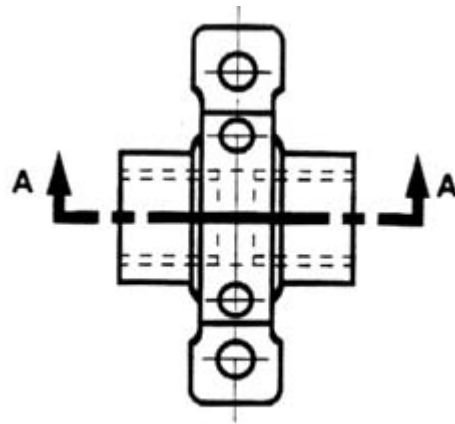


Figure 19 The top "outside" view of the bearing

Half-Sections

A half-section is a view of an object showing one-half of the view in section, as in figure 20a and b.

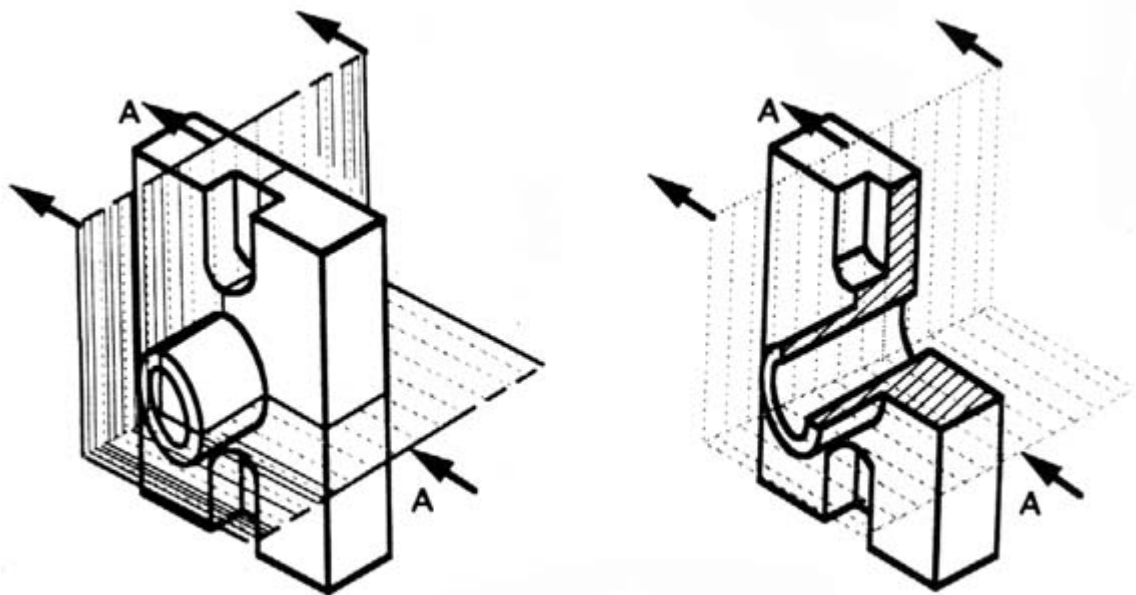


Figure 20a Full and sectioned isometric views

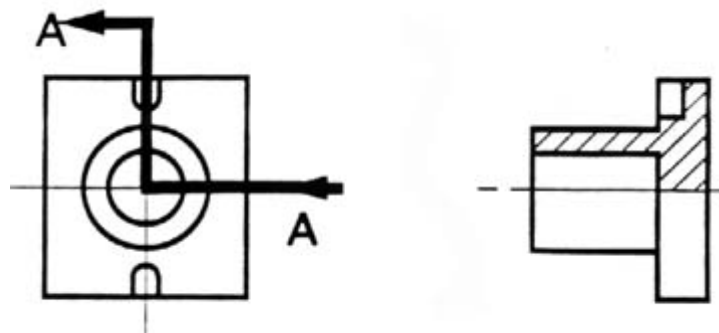


Figure 20b Front view and half section

The diagonal lines on the section drawing are used to indicate the area that has been theoretically cut. These lines are called *section lining* or *cross-hatching*. The lines are thin and are usually drawn at a 45-degree angle to the major outline of the object. The spacing between lines should be uniform.

A second, rarer, use of cross-hatching is to indicate the material of the object. One form of cross-hatching may be used for cast iron, another for bronze, and so forth. More usually, the type of material is indicated elsewhere on the drawing, making the use of different types of cross-hatching unnecessary.

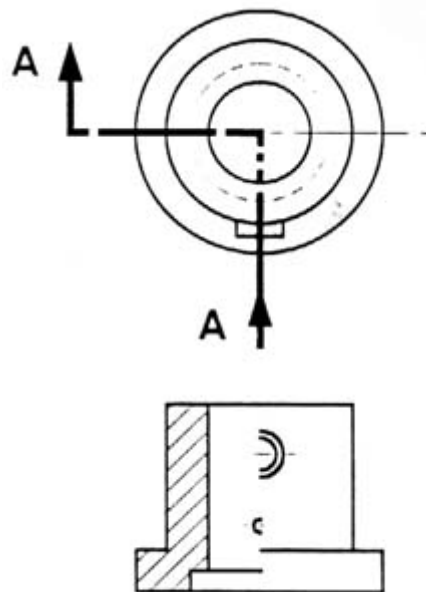


Figure 21 Half section without hidden lines

Usually hidden (dotted) lines are not used on the cross-section unless they are needed for dimensioning purposes. Also, some hidden lines on the non-sectioned part of the drawings are not needed (figure 12) since they become redundant information and may clutter the drawing.

Sectioning Objects with Holes, Ribs, Etc.

The cross-section on the right of figure 22 is technically correct. However, the convention in a drawing is to show the view on the left as the preferred method for sectioning this type of object.

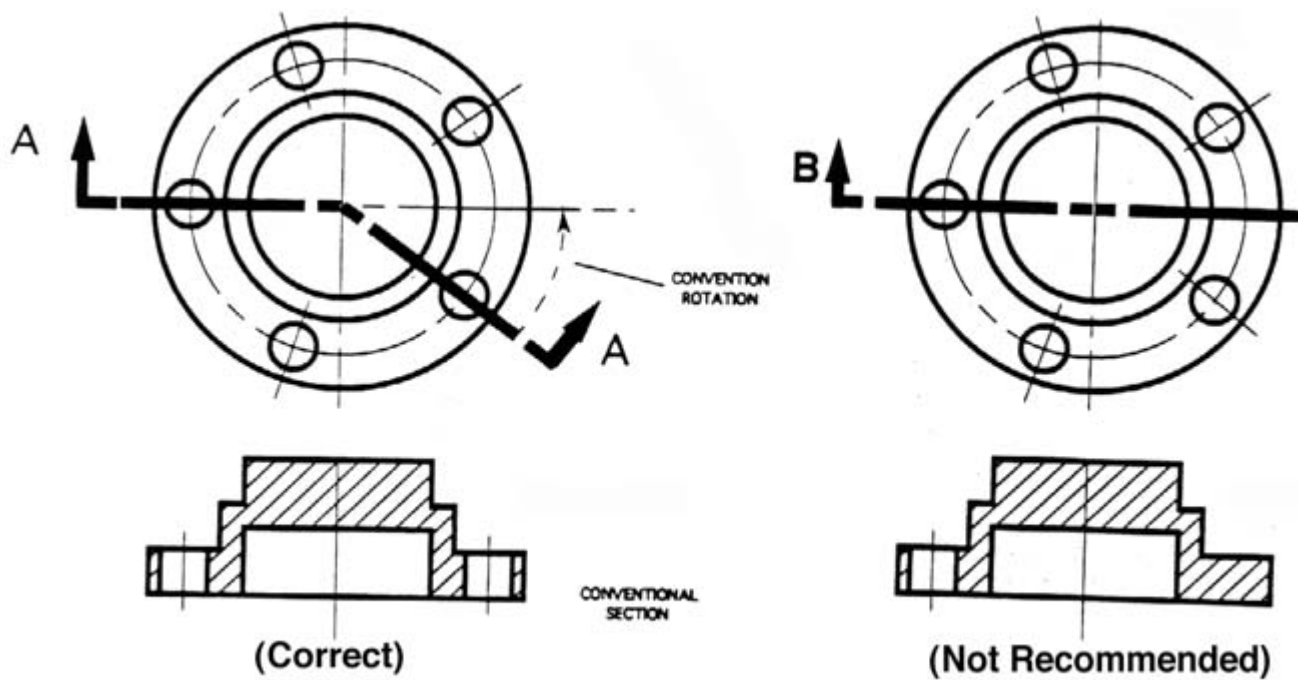


Figure 22 Cross section

Dimensioning

The purpose of dimensioning is to provide a clear and complete description of an object. A complete set of dimensions will permit only one interpretation needed to construct the part. Dimensioning should follow these guidelines.

1. Accuracy: correct values must be given.
2. Clearness: dimensions must be placed in appropriate positions.
3. Completeness: nothing must be left out, and nothing duplicated.
4. Readability: the appropriate line quality must be used for legibility.

The Basics: Definitions and Dimensions

The **dimension line** is a thin line, broken in the middle to allow the placement of the dimension value, with arrowheads at each end (figure 23).

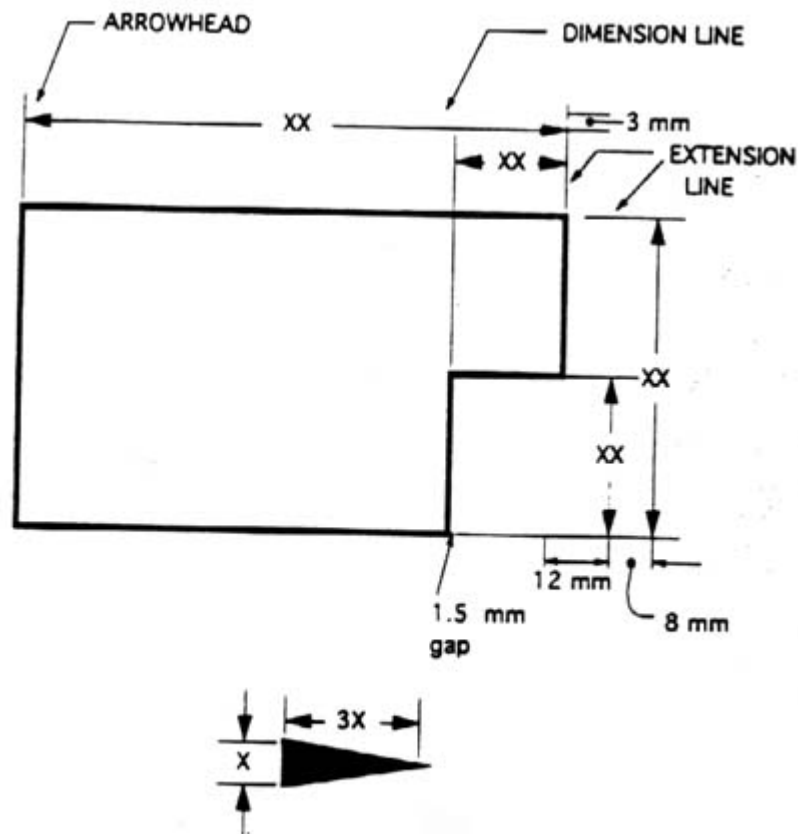


Figure 23 Dimensioning drawing

An **arrowhead** is approximately 3 mm long and 1 mm wide. That is, the length is roughly three times the width. An **extension line** extends a line on the object to the dimension line. The first dimension line should be approximately 12 mm (0.6 in) from the object. Extension lines begin 1.5 mm from the object and extend 3 mm from the last dimension line.

A leader is a thin line used to connect a dimension with a particular area (figure 24).

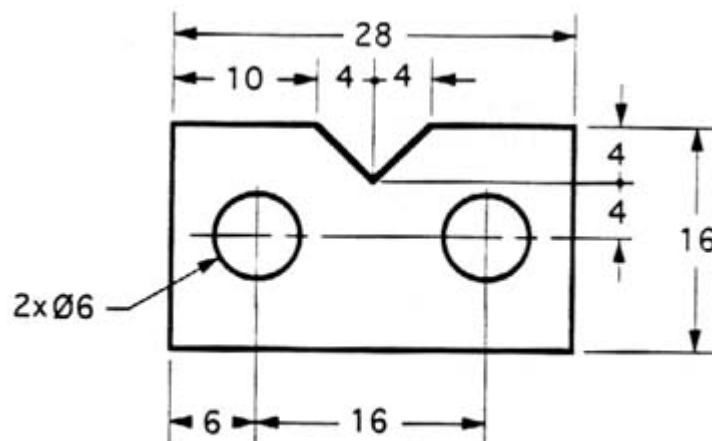


Figure 24 Example drawing with a leader

A leader may also be used to indicate a note or comment about a specific area. When there is limited space, a heavy black dot may be substituted for the arrows, as in figure 23. Also in this drawing, two holes are identical, allowing the "2x" notation to be used and the dimension to point to only one of the circles.

Where To Put Dimensions

The dimensions should be placed on the face that describes the feature most clearly. Examples of appropriate and inappropriate placing of dimensions are shown in figure 25.

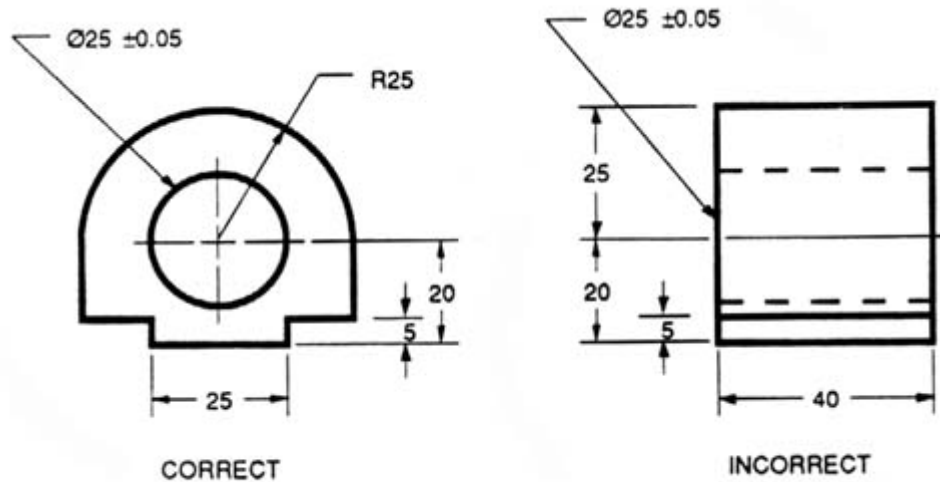


Figure 25 Example of appropriate and inappropriate dimensioning

In order to get the feel of what dimensioning is all about, we can start with a simple rectangular block. With this simple object, only three dimensions are needed to describe it completely (figure 26). There is little choice on where to put its dimensions.

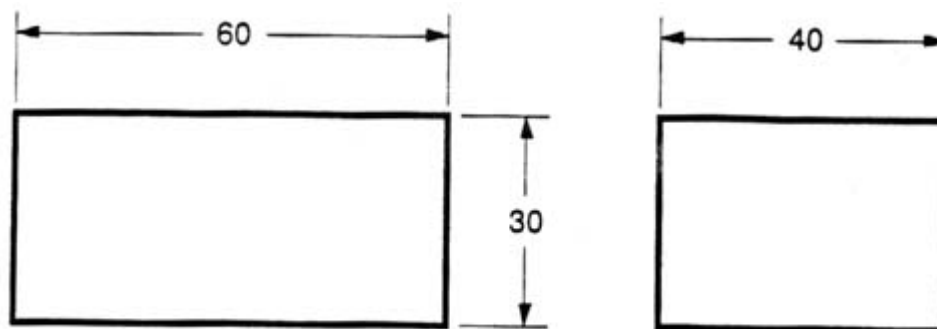


Figure 26 Simple object

We have to make some choices when we dimension a block with a notch or cutout (figure 27). It is usually best to dimension from a common line or surface. This can be called the datum line of surface. This eliminates the addition of measurement or machining inaccuracies that would come from "chain" or "series" dimensioning. Notice how the dimensions originate on the datum surfaces. We chose one datum surface in figure 27, and another in figure 28. As long as we are consistent, it makes no difference. (We are just showing the top view).

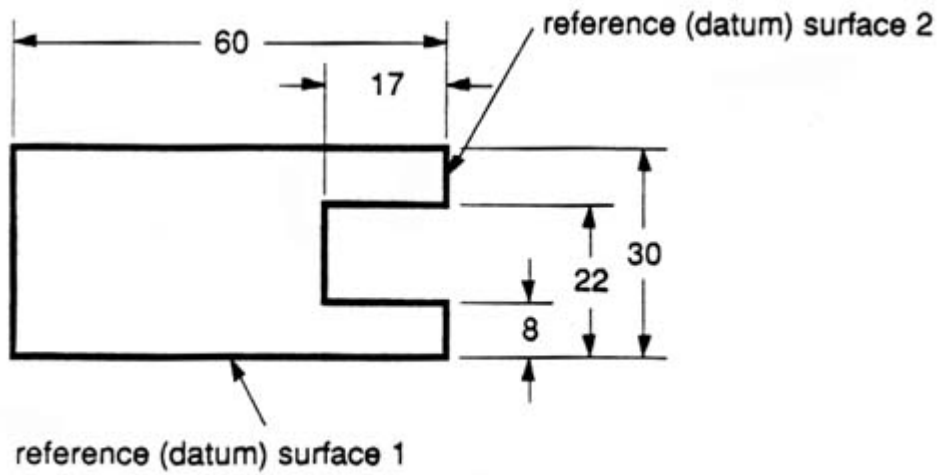


Figure 27 Surface datum example

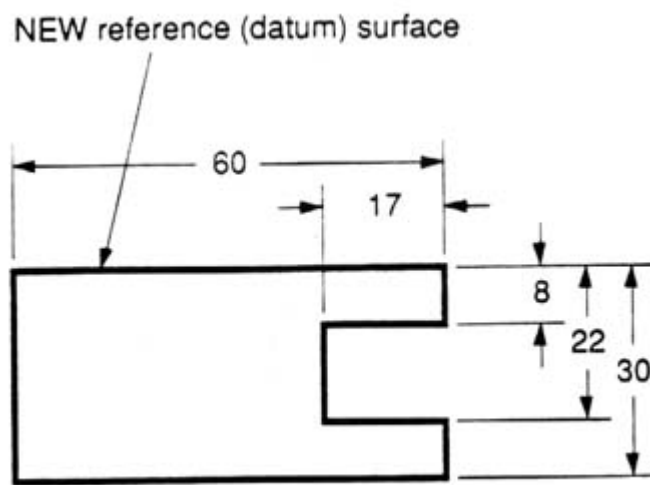


Figure 28 Surface datum example

In figure 29 we have shown a hole that we have chosen to dimension on the left side of the object. The \varnothing stands for "diameter".

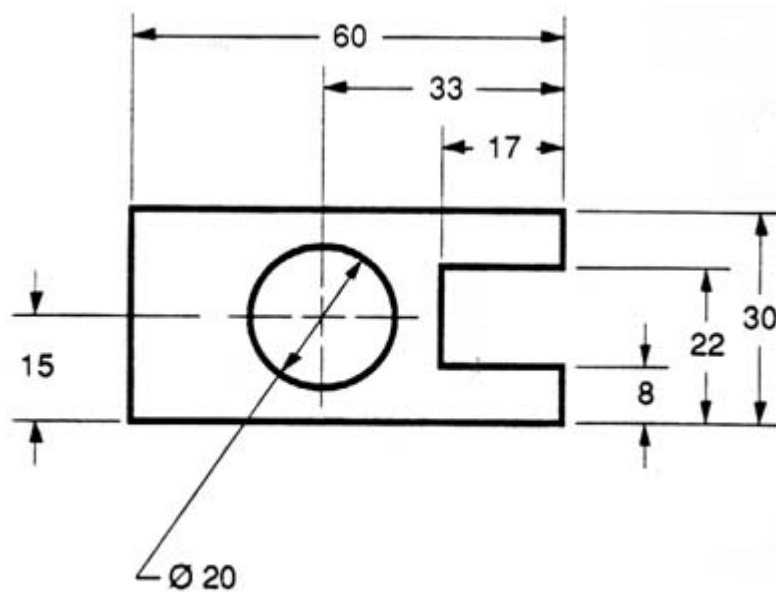


Figure 29 Example of a dimensioned hole

When the left side of the block is "radiuses" as in figure 30, we break our rule that we should not duplicate dimensions. The total length is known because the radius of the curve on the left side is given. Then, for clarity, we add the overall length of 60 and we note that it is a reference (REF) dimension. This means that it is not really required.

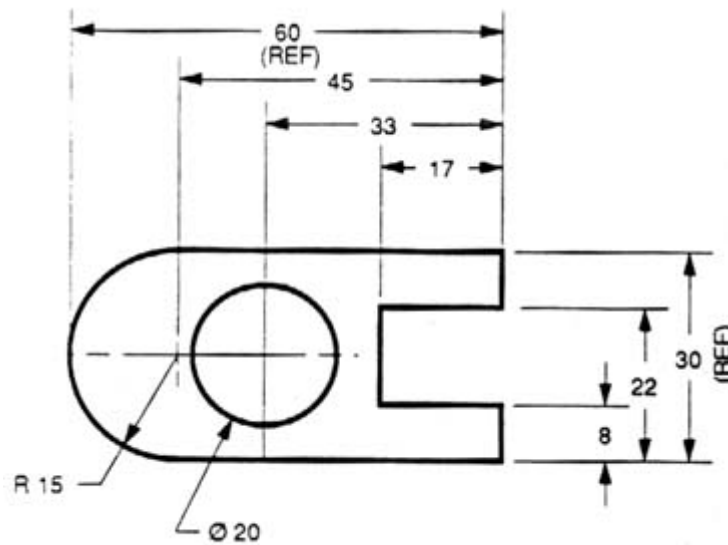


Figure 30 Example of a directly dimensioned hole

Somewhere on the paper, usually the bottom, there should be placed information on what measuring system is being used (e.g. inches and millimeters) and also the scale of the drawing.

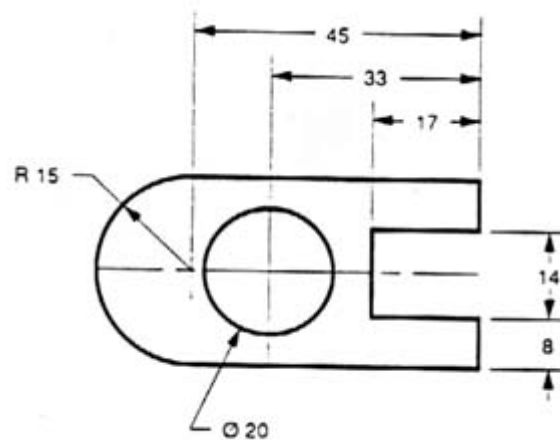


Figure 31 Example of a directly dimensioned hole

This drawing is symmetric about the horizontal centerline. Centerlines (chain-dotted) are used for symmetric objects, and also for the center of circles and holes. We can dimension directly to the centerline, as in figure 31. In some cases this method can be clearer than just dimensioning between surfaces.